



MUC-MUH/O/R/S/T

MATRICI DI TRANCIATURA SENZA TESTA: ISO 8977 SCARICO CONICO HEADLESS BUTTON ISO 8977 CONICAL

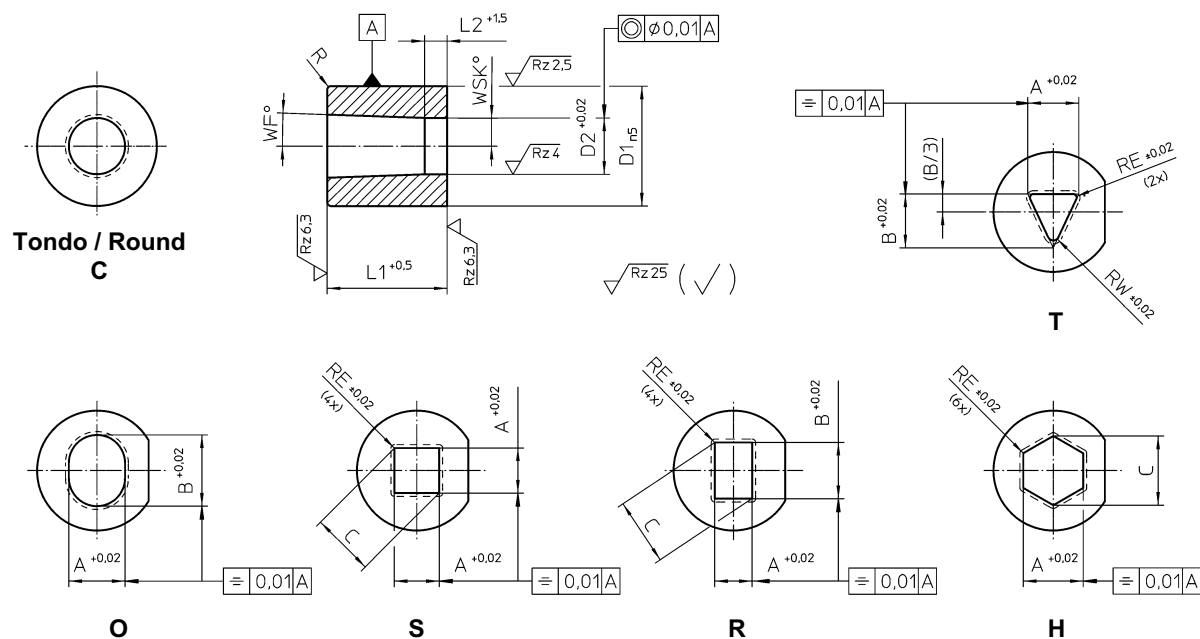

MMC-MMH/O/R/S/T

MATRICI DI TRANCIATURA CON TESTA: ISO 8977 SCARICO CONICO SHOULDER BUTTON ISO 8977 CONICAL

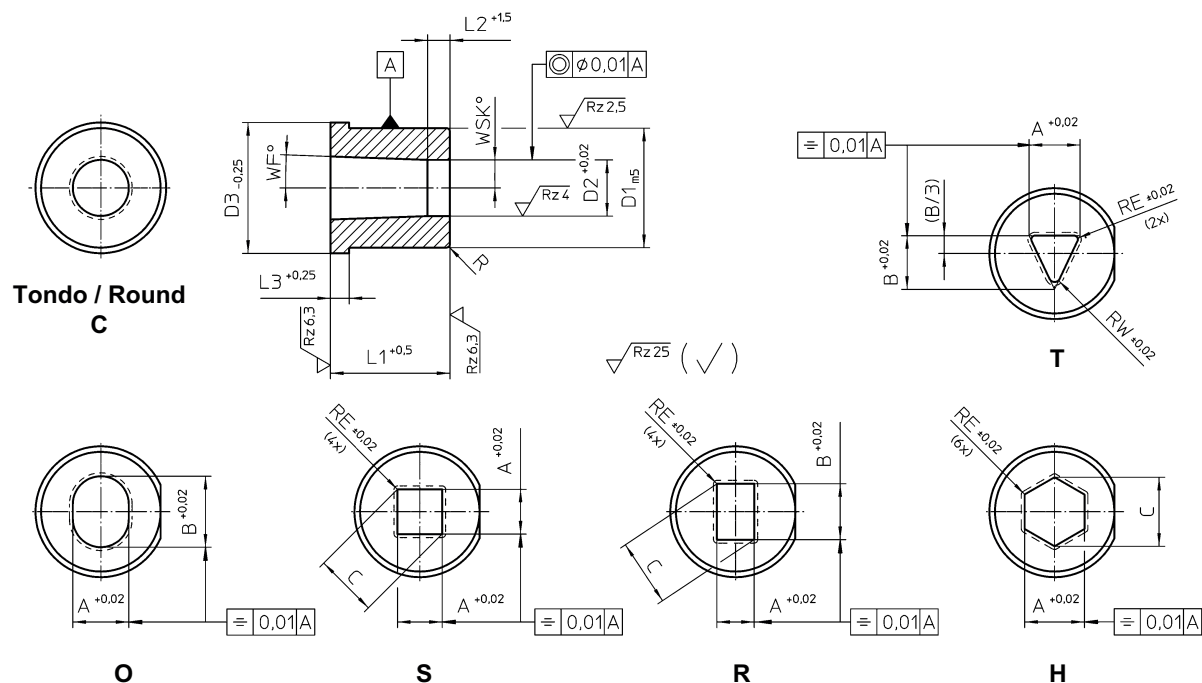

Matrice senza testa / Headless Button

D1	ROUND	TYPE						L1	L2	RE order/ or RW	R ca.	WSK°	WF°
	D2	A		B			C						
	From - To	O,S,R, H,T	T	O	R	T	S,R,H						
		min	max	max			max						
10	1,6 - 5,0	1,6	4,3	5,0	4,7	3,8	5,0	22 25 28 30 32 35	4	Stand. 0,2 max A/2	0,4	Stand. Variable bis 0,5°	1°
13	3,0 - 7,2	1,8	6,2	7,2	6,9	5,4	7,2		5		0,8		
16	5,0 - 8,8	2,5	7,6	8,8	8,4	6,6	8,8		6				
20	5,5 - 11,0	3,2	9,5	11,0	10,5	8,3	11,0		8		1,5		
22	7,5 - 14,0	4,0	12,1	14,0	13,4	10,5	14,0						
25	9,5 - 16,5	4,8	14,3	16,5	15,7	12,4	16,5						
32	13,0 - 20,0	5,5	17,3	20,0	19,2	15,0	20,0						
38	16,0 - 26,0	6,4	22,5	26,0	25,2	19,5	26,0						
40	16,6 - 26,0												
45	22,0 - 31,0	7,5	26,8	31,0	30,0	23,3	31,0						
50	24,0 - 34,0	8,0	29,4	34,0	33,0	25,5	34,0						
56	26,0 - 38,0	8,5	32,9	38,0	37,0	28,5	38,0						
63	30,0 - 43,0	9,0	37,2	43,0	42,0	32,3	43,0						
71	34,0 - 48,0	9,5	41,6	48,0	47,0	36,0	48,0						

Matrici con testa / Shoulder Button

D1	ROUND	D3	TYPE						L1	L2	RE order/ or RW	R ca.	WSK°	WF°		
	D2		A		B			C								
	From - To		O,S,R, H,T	T	O	R	T	S,R,H								
			min	max	max			max								
10	1,6 - 5,0	13	1,6	4,3	5,0	4,7	3,8	5,0	22 25 28 30 32 35	4	Stand. 0,2 max A/2	0,4	Stand 0°, Variabel bis 0,5°	1°		
13	1,8 - 7,2	16	1,8	6,2	7,2	6,9	5,4	7,2		5		0,8				
16	5,0 - 8,8	19	2,5	7,6	8,8	8,4	6,6	8,8							6	1,0
20	5,5 - 11,0	23	3,2	9,5	11,0	10,5	8,3	11,0		8		1,5				
22	7,5 - 14,0	25	4,0	12,1	14,0	13,4	10,5	14,0								
25	9,5 - 16,5	28	4,8	14,3	16,5	15,7	12,4	16,5								
32	13,0 - 20,0	35	5,5	17,3	20,0	19,2	15,0	20,0								
38	16,0 - 26,0	41	6,4	22,5	26,0	25,2	19,5	26,0								
40	16,5 - 26,0	43														
45	22,0 - 31,0	48														